


RIGHT/REAR

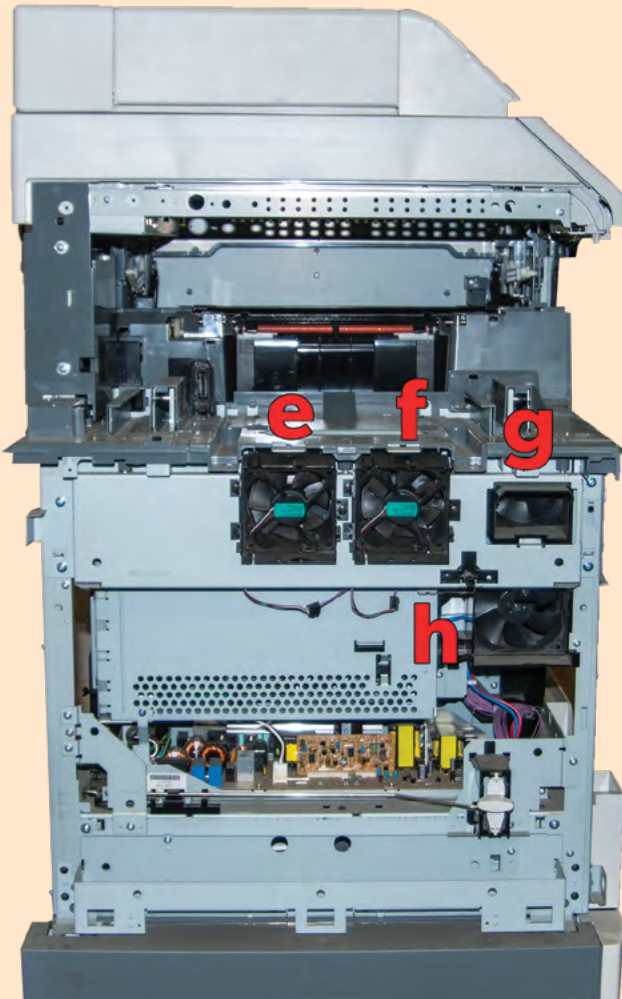

LEFT

PRINTER REPAIR ARTICLE

# CLJ 4730, CM4730 Fan Identification

Large printers have a lot of fans. The HP CLJ 4700 family has nine, if you include the one in the optional duplexer.

As with all Laserjets, if a fan fails, the control panel displays a 57.xx code to tell you which fan has failed. One consults the Control Panel Messages section of the service manual to see which fan is indicated by the code. In this case, there is a problem: there is no easy way to tell which fan to order. For example, the 57.06 error is associated with "Control Fan 2," wherever that might be. The part number lists are of little use because all fans are described simply as "Fan."

But not to worry. We at Liberty Parts Team have completed the picture by providing the part numbers, as well as figures, with the correspondences. Just match the letter assignments below with those in the figures.

**LPT**

Code	Ltr	Part #	Location
57.01	g	RM1-2178 [fan and duct asm]	Delivery
57.03	c	RK2-0621	Sub-power supply
57.04	h	RK2-0623	Cartridge
57.05 or 57.05A	*	RK2-0648	Duplexer fan (*not shown, above fuser, below scanner/ADF)
57.06	f	RK2-0621	"Control 2"
57.07	e	RK2-0621	"Control 1"
57.08	a	RK2-0622	ETB
57.09	b	RK2-0621	Fuser
57.0A	d	RK2-0622	Power supply